
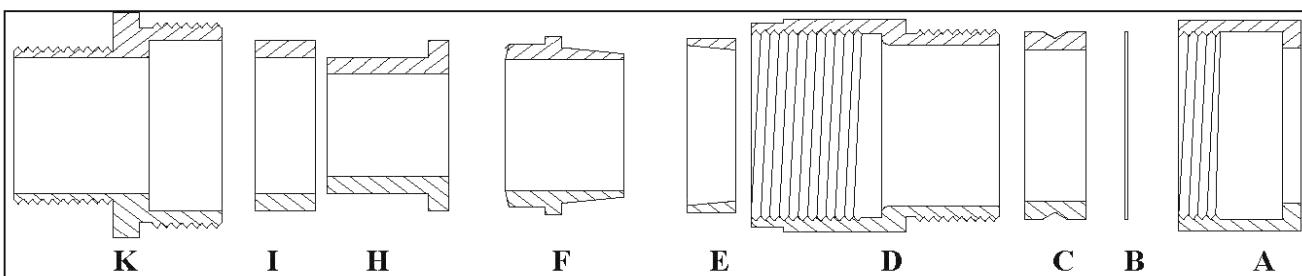


ASSEMBLY INSTRUCTIONS

Assembly Instructions For S.E.M.C. Type VBL453 Flameproof Cable Gland

TYPE OF PRODUCTION :	EExdIIC	BASEEFA CERTIFICATION NO.: Ex98D1230U
FUNCTION:	PROVIDES FOR ARMOUR CLAMP PROVIDES SEAL ON THE OUTER SHEATH OF CABLE PROVIDES SEAL ON THE INNER SHEATH OF CABLE	
APPROVAL: SUITABLE FOR USE IN GROUP IIA,IIB,AND IIC SUITABLE FOR USE IN ZONE 1 AND ZONE 2		

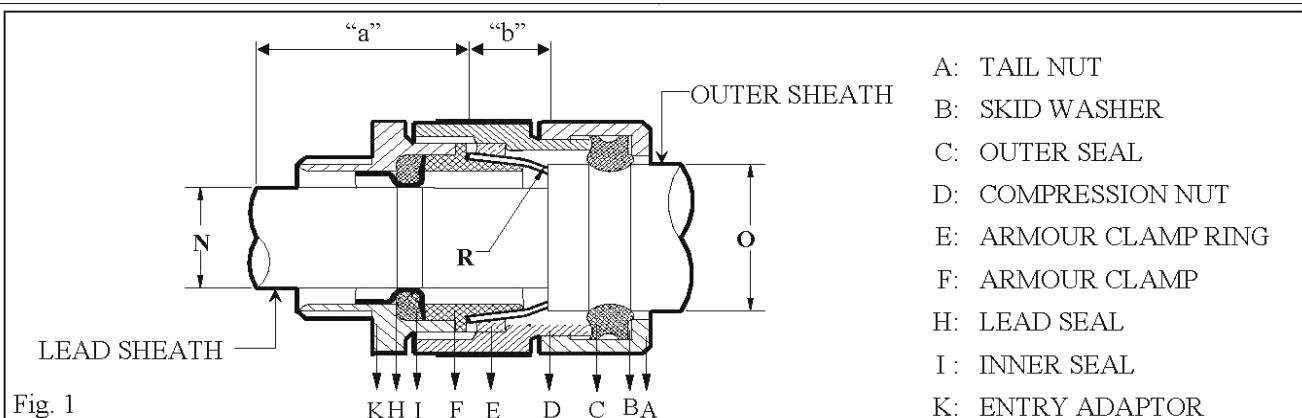

Gland Size		Across Flat	Diameter of Lead Sheath		Diameter of Outer Sheath		Outer Sheath Cut "a" Min.	Armour Wire Cut "b" Min.	Standard Steel Wire Armour R
Ref.	Metric*		N Min.	N Max.	O Min.	O Max.			
O	20	25	7.5	9.0	10.5	16.0	75	19	0.9/1.25
A	20	30	8.3	11.6	12.9	20.5	75	19	0.9/1.25
B	25	36	11.5	16.6	17.0	26.5	75	19	1.25/1.6
Cs	32	46	15.0	18.3	25.0	33.3	75	19	1.6/2.0
C	32	46	19.3	22.8	25.0	33.3	75	19	1.6/2.0
C2s	40	55	20.0	24.8	33.0	42.0	75	19	1.6/2.0
C2	40	55	25.0	28.8	33.0	42.0	75	19	1.6/2.0
Ds	50	65	32.0	34.3	39.5	52.0	75	21	2.0/2.5
D	50	65	38.0	38.8	39.5	52.0	75	21	2.0/2.5
Ess	63	80	40.0	42.8	52.0	64.8	75	21	2.5
Es	63	80	42.0	46.8	52.0	64.8	75	21	2.5
E	63	80	46.0	51.8	52.0	64.8	75	21	2.5

*Metric entry threads are 1.5mm pitch. Other threads are available, refer to stamping details on the gland for actual thread type and size.

All dimensions in millimeters.

S.E.M.C. CABLE GLAND SYSTEM

LIMITATIONS:

- (a)** The gland shall be installed in accordance with the relevant code of practice e.g. BS 5345.
- (b)** The gland shall not be modified in any way.
- (c)** The type VBL 453 range of flameproof compression glands is not suitable for the use with flameproof enclosures of group IIC having a volume greater than 2000cc (refer to the relevant code of practice for their use with enclosures of 2000cc and less).
- (d)** The minimum number of full threads engaged and depth of thread engagement between a flameproof gland and flameproof equipment shall be in accordance with the requirements of the appropriate standard e.g. EN50018.

ASSEMBLY INSTRUCTION:

1. Place the cable alongside the apparatus and cut off any surplus, allowing sufficient length for connecting the cores to the appropriate terminals.
2. Prepare cable for terminating in the following manner: Remove the outer sheath and armour to at least dimension "a", then cut back outer sheath in accordance with dimension "b", see the table on page 1 and figure 1.
3. Pass the shroud over the outer sheath, if required .Then pass part A (including part C&B) and then part D over the outer sheath.
4. Pass part E (Smaller end of taper first) over the armor. Then splay the armor evenly and locate the tapered end of part F under it, as shown in fig1.
5. Engage and tighten part K into the equipment (secure with a locknut if required).See limitation (a).
6. Pass the inner seal parts (lead seal, part H, fitted into part I) over the lead sheath of the cable ensuring that the flanged end of the seal assembly is adjacent to the part F.
7. Feed the lead sheath of the cable through part K until part F fits into the counterbore.
8. Push the cable towards the equipment then locate and tighten part D onto part K, to clamp the armor and form a seal between part (i.e. H & I) and the lead sheath of the cable. If difficulty is found in engaging part D onto part K, then proceed according to instructions 9 through 11; otherwise proceed with instruction No.12.
9. Remove the cable cable and parts I & H from K. Push the cable towards the equipment then locate and tighten part D onto part K, to clamp the armor.
10. Un-tighten part D and remove it and the cable from part K. Check the tightness of part K in the equipment and put parts I & H back into the counterbore, as shown in fig.1.
11. Feed the lead sheath through and locate and tighten part D onto part K until a seal is formed between inner seal parts, I & H, as shown in fig. 1. The lead sheath shall protrude through part K into the equipment to ensure that there is sufficient surface for sealing.
12. Locate and tighten part A onto part D until a seal is formed between part C and the outer sheath, if difficulty is found in forming a seal, un tighten part A half a turn then retighten.
13. Locate the shroud over the gland, if applicable.

محدودیت ها :

- الف) گلند می بایست دقیقاً مطابق با استاندارد مربوطه ، استاندارد Nصب تجهیزات الکتریکی) نصب گردد.
- ب) گلند به هیچ وجه و در هیچ شرایطی نباید مورد دستکاری قرار گیرد.
- ج) گلند خد انجار نوع VBL 453 برای نصب روی تجهیزات ضد انجار نوع EExd IIC نصب با حجم بیشتر از ۲۰۰۰ سی سی باشد، مناسب نیست.
- د) حداقل تعداد رزوه های بسته شده گلند و عمق دبواره محفظه خد انجار ، می بایست مطابق با الزامات استاندارد محصول باشد.(استاندارد EN 50018).

دستور نصب :

۱. ابتدا کابل مورد نظر را به سمت محفظه ، تنظیم کنید و کابل را به اندازه مناسب برای اتصال به ترمینال های داخل محفظه به طور یکنواخت قطع کنید.
۲. آماده سازی کابل برای مرحله نهایی به طریق انجام میگیرد : روکش بیرونی و زره را به حداقل اندازه " a " بردارید سپس روکش بیرونی را مطابق اندازه " b " ببرید (جدول ۱ و شکل ۱ را ببینید).
۳. شروع (در صورت استفاده) را از روی روکش خارجی کابل رد کنید. سپس قطعه A (شامل قطعات B و C) و بعد قطعه D را از روی روکش بیرونی رد کنید.
۴. قطعه E را از انتهای تنگ تر و از روی زره و قطعه F را از سمت مخروطی روی روکش داخلی به طوری که قسمت زیر زره قرار گیرد ، وارد نمایید. سپس زره را به صورت یکنواخت روی قسمت مخروطی قطعه F پخش کنید.
۵. قطعه K را از سمت رزوه دار (نری/male) توسط مهره مربوطه (locknut) و یا بدون مهره (در صورتیکه بدن تجهیز، رزوه دار باشد) به محفظه وصل و محکم نمایید (توجه به محدودیت های ذکر شده در بند ۱۰ صفحه ۱).
۶. قطعات سیل داخلی (سیل سربی H ، کامل شده با قطعه I) را از روی روکش سربی کابل رد کنید به طوریکه مطمئن شوید لبه انتهایی سیل مونتاژ شده با قطعه F تنظیم شده است.
۷. روکش سربی کابل را از میان قطعه K رد کنید تا آنجا که قطعه F به قطعه K می رسد.
۸. کابل را به سمت محفظه فشار دهید سپس قطعه D را به منظور نگهداری و منگه کردن زره و آب بندی بین قطعات سیل داخلی (i.e.H & I) و روکش سربی کابل به قطعه K وصل و محکم نمایید. اگر مشکلی در حین اجرای این مرحله پیدا شد، مطابق مراحل ۹ تا ۱۱ زیر ادامه دهید ، در غیر اینصورت و عدم بروز مشکل ، به مرحله ۱۲ مراجعه نمایید.
۹. قطعات (H & I) و کابل را از قطعه K جدا کنید. کابل را به سمت محفظه بفسارید سپس قطعه D را به منظور منگه کردن زره به قطعه K وصل و محکم نمایید.
۱۰. قطعه D را به همراه کابل از قطعه K باز و جدا نمایید سپس مجدداً کابل را وارد قطعه K نموده و پس از اطمینان از محکم بودن قطعه K به بدن تجهیز قطعات H & I را داخل قطعه K قرار دهید (مراجعه به تصویر ۱).
۱۱. کابل را مجدداً وارد نموده و قطعه D را روی قطعه K ببنید تا جاییکه روکش سربی کابل همانگونه که در تصویر ۱ دیده می شود توسط قطعه I & H آب بندی گردد. روکش سربی کابل می بایست به اندازه کافی از قطعه K به داخل محفظه وارد شده باشد تا از آب بندی صحیح آن اطمینان کامل حاصل شود.
۱۲. قطعه A را به روی رزوه های قطعه D جاگذاری و تا جاییکه آب بندی بین قطعات C و روکش خارجی کابل صورت پذیرد محکم کنید. در صورت بروز مشکل حین آب بندی ، قطعه A را تا نیمه باز و مجدداً ببنید.
۱۳. در پایان و در صورت استفاده از شروع آن را روی مجموعه گلند بسته شده بکشید.

دستورالعمل نصب
دستورالعمل نصب گلند ضد انفجار نوع VBL 453

EExdIIC



نوع حفاظت:

Ex98D1230U

شماره گواهی:

عملکرد:
آماده شده برای ARMOUR CLAMP
آماده شده برای آب بندی روگش بیرونی کابل
آماده شده برای آب بندی روکش داخلی کابل

تاییدیه:
مناسب برای استفاده در گروههای IIA, IIB, AND IIC
مناسب برای استفاده در ZONE 1 AND ZONE 2
مناسب برای استفاده در 2

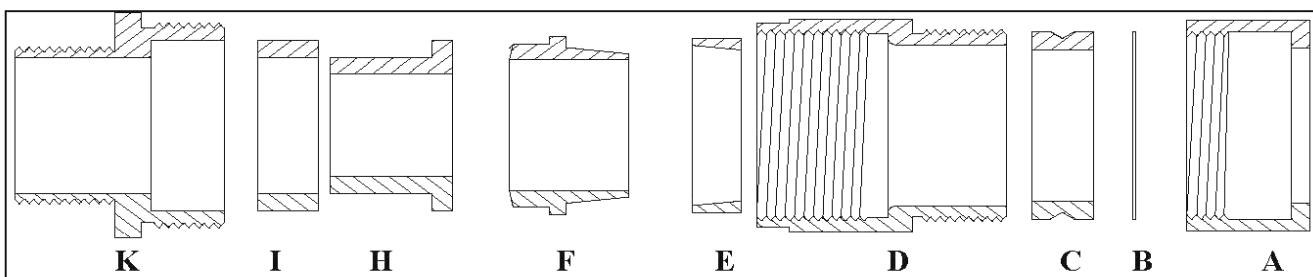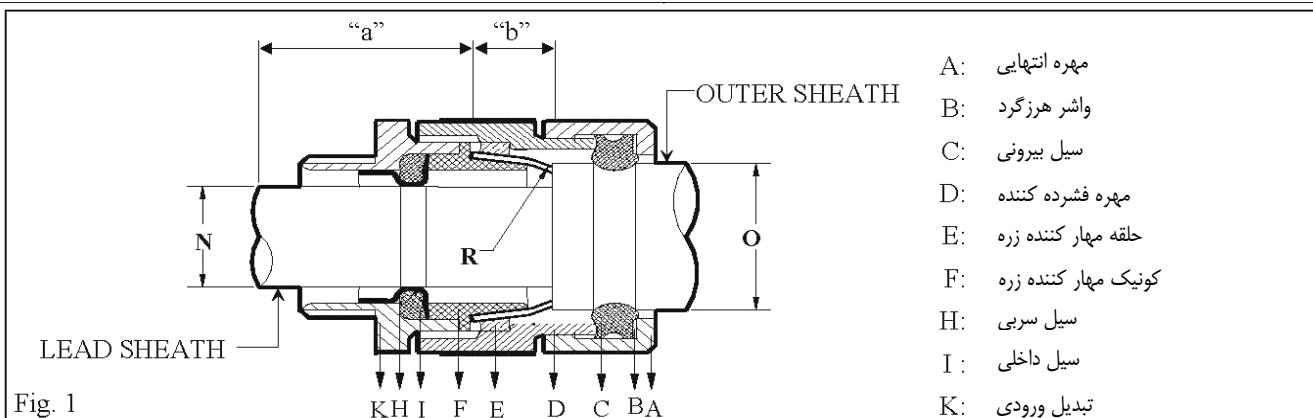

Ref.	Metric*	سایز گلند	قطر قسمت آچارخور (سطح به سطح)	قطر روکش سربی		قطر روکش بیرونی		روکش بیرونی بروش "a" Min.	سیم زره بروش "b" Min.	استاندارد زره سیمی استیبل R
				N Min.	N Max.	O Min.	O Max.			
O	20	25	7.5	9.0	10.5	16.0	75	19	0.9/1.25	
A	20	30	8.3	11.6	12.9	20.5	75	19	0.9/1.25	
B	25	36	11.5	16.6	17.0	26.5	75	19	1.25/1.6	
Cs	32	46	15.0	18.3	25.0	33.3	75	19	1.6/2.0	
C	32	46	19.3	22.8	25.0	33.3	75	19	1.6/2.0	
C2s	40	55	20.0	24.8	33.0	42.0	75	19	1.6/2.0	
C2	40	55	25.0	28.8	33.0	42.0	75	19	1.6/2.0	
Ds	50	65	32.0	34.3	39.5	52.0	75	21	2.0/2.5	
D	50	65	38.0	38.8	39.5	52.0	75	21	2.0/2.5	
Ess	63	80	40.0	42.8	52.0	64.8	75	21	2.5	
Es	63	80	42.0	46.8	52.0	64.8	75	21	2.5	
E	63	80	46.0	51.8	52.0	64.8	75	21	2.5	

* گام دنده های متریک ورودی 1.5mm می باشد. دنده های دیگری هم وجود دارد؛ برای اندازه و نوع حقیقی دنده ها به جزئیات استامپ روی گلند رجوع شود.

تمامی اندازه ها به میلیمتر میباشند.